

FMS 30-34 B

Photoelectric diffuse sensor



PRODUCT HIGHLIGHTS

- Scanning distance: 5 ... 1000 mm, adjustable
- Wide beam (large aperture angle)
- Separating seam
- Metal M30 threaded sleeve
- Contamination indicator

Optical data		Functions	
Scanning distance	5 ... 1000 mm ¹	Indicator LED, green	Operating voltage indicator
Type of light	Infrared, 880 nm	Indicator LED, yellow	Switching output indicator
Distance hysteresis	≤ 10 % of set scanning distance	Indicator LED, red	Contamination indicator
Aperture angle	50°	Sensitivity adjustment	Via 18-step potentiometer
Electrical data		Mechanical data	
Operating voltage, +U _B	10 ... 30V DC ²	Dimensions	See dimensional drawings
No-load current, I ₀	≤ 40 mA	Enclosure rating	IP 65 ³
Output current, I _e	≤ 200 mA	Material, housing	Brass, nickel-plated
Pull-up resistance	22 kΩ	Type of connection	See selection table
Pull-down resistance	22 kΩ	Ambient temperature: operation	-20 ... +60 °C
Protective circuits	Reverse-polarity protection, U _B / short-circuit protection (Q)	Ambient temperature: storage	-40 ... +80 °C
Protection Class	2	Weight (plug device)	170 g
Power On Delay	≤ 300 ms	Weight (cable device)	280 g
Switching output, Q	PNP/NPN	Vibration and impact resistance	60947-5-2
Output function	N.O.		
Switching frequency, f (ti/tp 1:1)	50 Hz		




¹ Reference material: white, 90 % reflectivity ² 10 % ripple, within U_B ³ With connected IP 65 plug

Scanning distance	Type of connection	Part number	Article number
5 ... 1000 mm	Plug, M12x1, 4-pin	FMS 30-34 B-L4	550-51596
5 ... 1000 mm	Cable, 3 m, 4-wire	FMS 30-34 B	550-51595

Sold & Serviced By:



Toll Free Phone (877) SERV098
www.electromate.com
sales@electromate.com

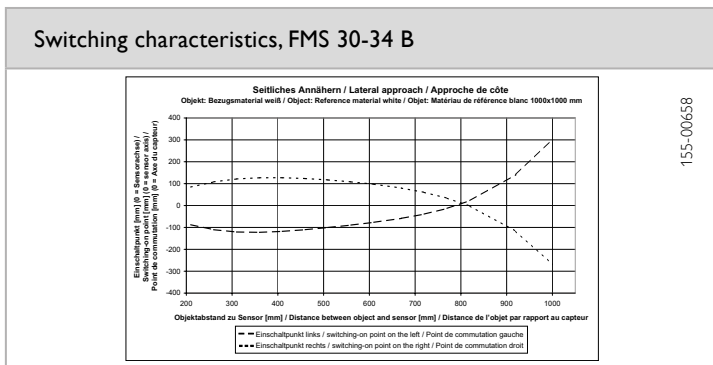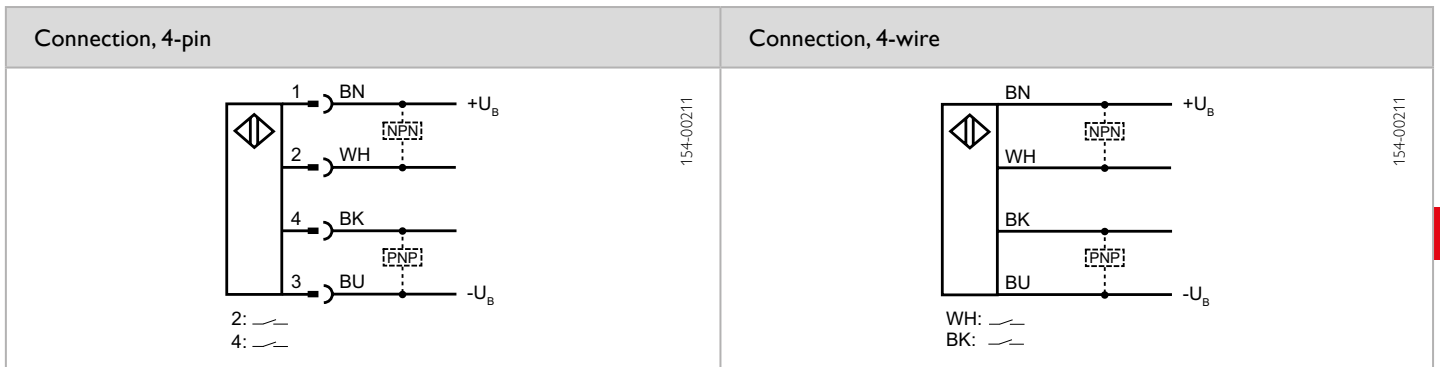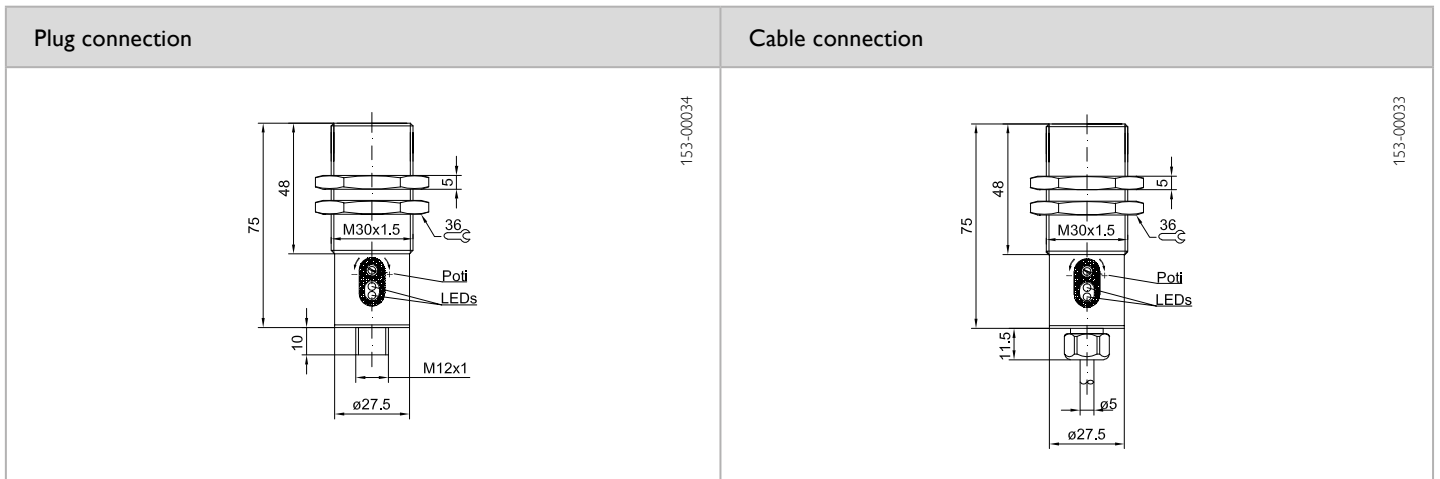

Accessories	
Connection cables	From Page A-38
Brackets	From Page A-4

Sold & Serviced By:



Toll Free Phone (877) SERV098
www.electromate.com
sales@electromate.com